


ATLAS PIXEL SYSTEM MODULE ASSEMBLY


M. Gilchriese
Lawrence Berkeley National Laboratory

March 12, 1999

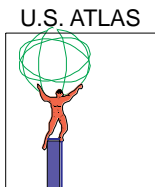


Pixel Module

Module is basic building block of system
Major effort to develop components and assemble prototypes. All modules identical.

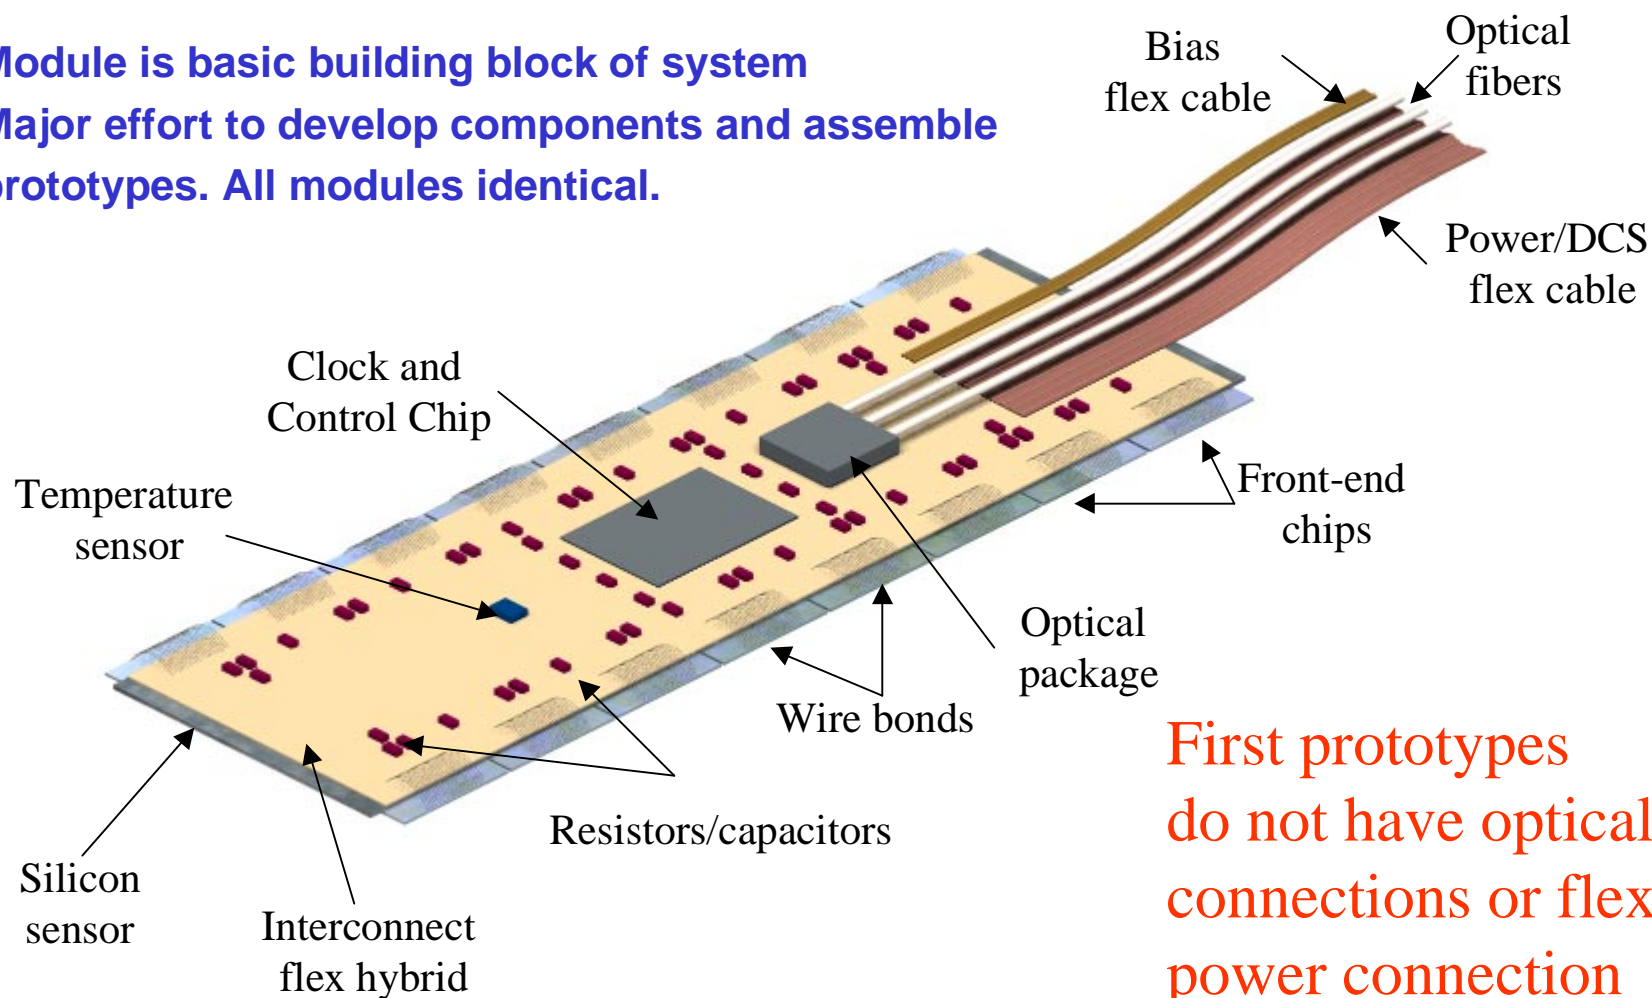


**First prototypes
do not have optical
connections or flex
power connection**

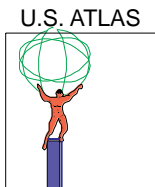

Items Covered in This Talk

- Bump deposition(or receiving metal) on IC and detector wafers
- Dicing, thinning and possibly backside metallization of these wafers
- Flip chip assembly to produce what we call “bare modules”
- Probing of bare modules(not done yet - production)
- Mounting flex hybrids with components on module
- Module burn in and testing
- Principal interfaces
 - ◆ Module attachment to mechanical structure
 - ◆ Cabling(power and optical links)

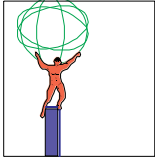


Assembly Process - Example

<u>ICs</u>		<u>Detectors</u>		<u>Flex</u>	
<u>Yield(%)</u>	<u>Step</u>	<u>Yield(%)</u>	<u>Step</u>	<u>Yield(%)</u>	<u>Step</u>
30.0%	Fab	100.0%	Fab	80.0%	Fab
99.9%	Ship	99.9%	Ship	99.9%	Ship
97.0%	Probe	90.0%	Probe	98.6%	Cut (from CLEOIII)
99.9%	Ship	99.9%	Ship	99.9%	Ship
97.0%	Bump deposition	97.0%	Bump deposition	100.0%	Probe
99.9%	Ship	99.9%	Ship	99.9%	Ship
99.5%	Inspection(bump yield)	92.3%	Inspection(bump yield)	95.0%	Mount components
99.9%	Ship	99.9%	Ship	99.9%	Ship
95.0%	Thin and metallize	97.0%	Dice	99.9%	Wire bond MCC (from CLEOIII)
99.9%	Ship	99.0%	Sort	97.0%	Probe/burn-in
97.0%	Dice	99.9%	Ship	99.9%	Ship
97.0%	Sort	99.0%	Inspect		
99.9%	Ship				
99.0%	Inspect				72%
Yield(%)	25%		76%		per flex
	per die		per tile		
		<u>Yield(%)</u>	<u>Module Assembly</u>		
		99.0%	Flip chip/die		
		85.1%	Flip chip/module		
		99.9%	Ship		
		99.0%	Inspect		
		99.9%	Ship		
		99.0%	Probe bare module		
		99.9%	Ship		
		98.0%	Attach flex		
		95.0%	Wire bond FE's (with repair)		
		98.0%	Attach pwr/optics		
		99.9%	Ship		
		95.0%	Test/burn in		
		99.9%	Ship		
			71%		
			per module		



M. Gilchriese

U.S. ATLAS Internal Review March 1999

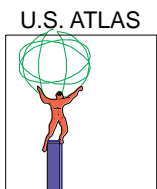

Pixel Modules

Module with flex hybrid and controller chip on PC board

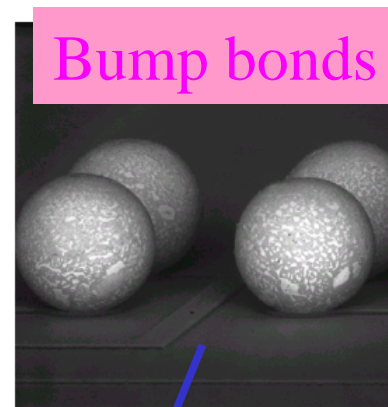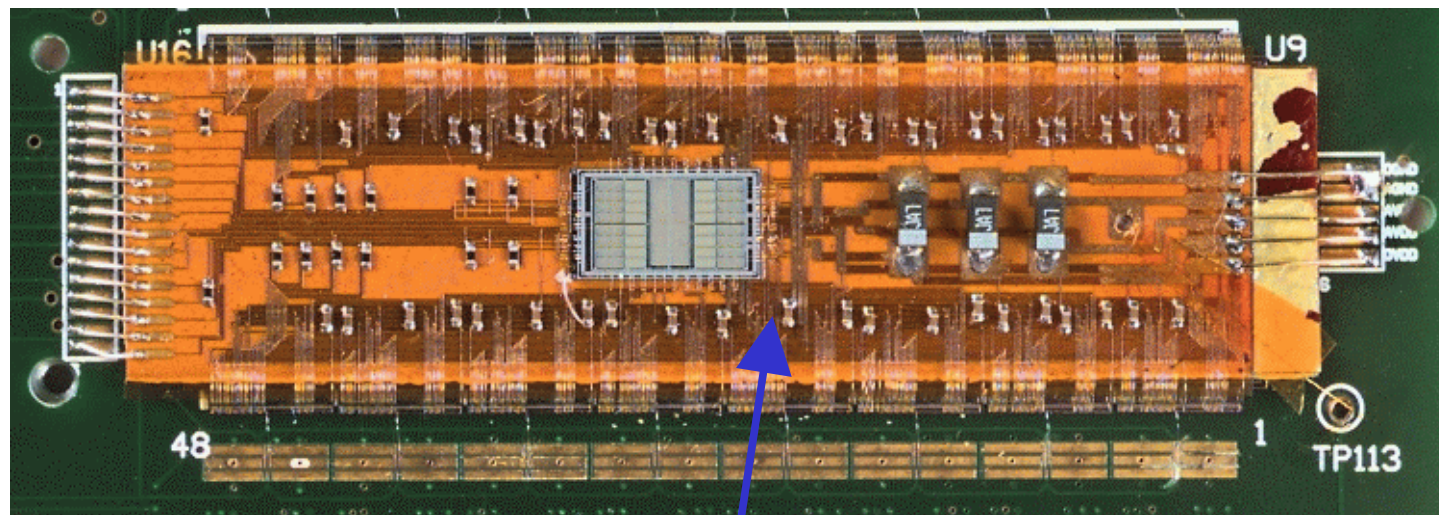


16 chips with 46,000 bump bonds

Xray of bumps

Sensor

ICs

M. Gilchriese
U.S. ATLAS Internal Review March 1999

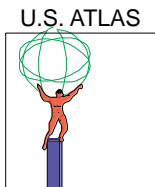

Bump Bonding

- Solder or indium bumps have been used so far in our prototype program.
- Different process flow for solder and indium and some small variations for fixed metal between vendors

Vendors

AIT(indium)¹

Alenia(indium)²

Boeing(indium)^{2,3}

GEC(solder)¹

IZM(solder)²


Sofradir(indium)⁴


¹ Used by others

² ATLAS parts made

³ No longer active


⁴ Contacts in process

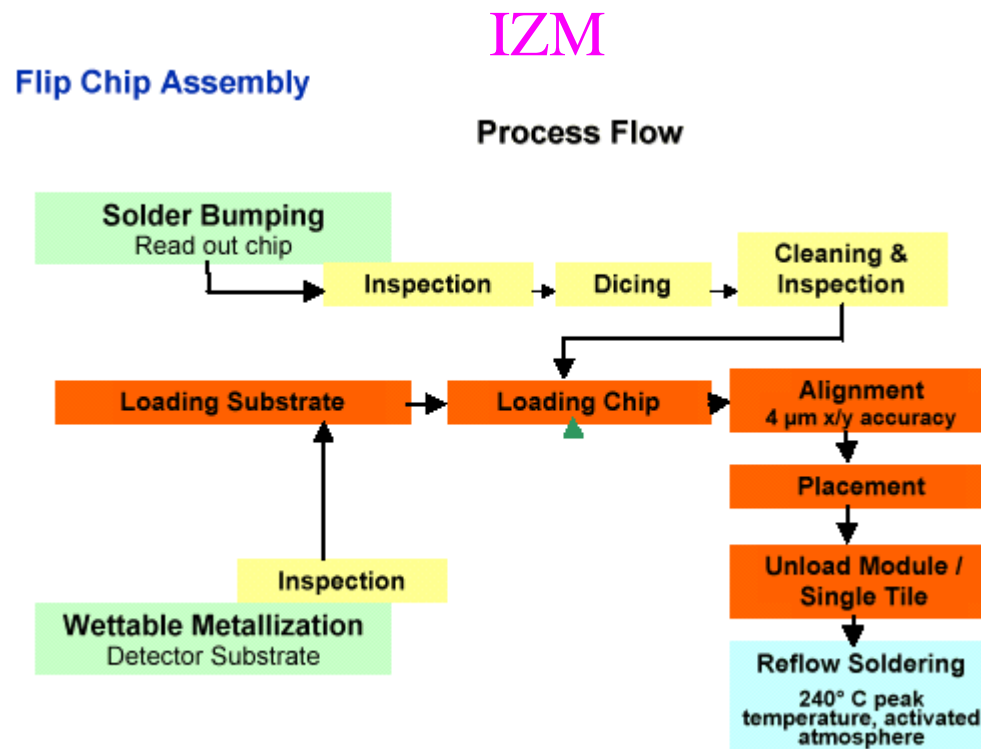

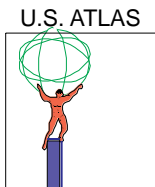


Bump Bonding- What Do We Know?

- Both indium and solder successful for prototypes but some concerns about indium(high resistance from oxides?)
- Defect rate for bump deposition is roughly 10^{-5} - 10^{-4} for both metals
- Visual inspection appears to be adequate to measure this
- Defect rate for flip chip assembly has varied greatly for prototypes and between vendors from about 10^{-4} - 10^{-2}
- X-ray inspection established with two vendors(IZM and here in Bay Area) and is adequate to measure flip-chip yield
- Thinning of bumped IC wafers to 150 microns and subsequent flip chip assembly has been demonstrated(on one 16 chip module) for indium only at the moment.
- Dicing of bumped wafers demonstrated with multiple vendors.
- Irradiated bumped(indium) detectors work. Bumping does not appear to affect detector properties adversely
- Tensile and shear strength measured. Creep studied. But all with low statistics.
- Preliminary price enquiry made to many vendors. Large differences in price(factor of 2)

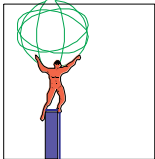


Examples

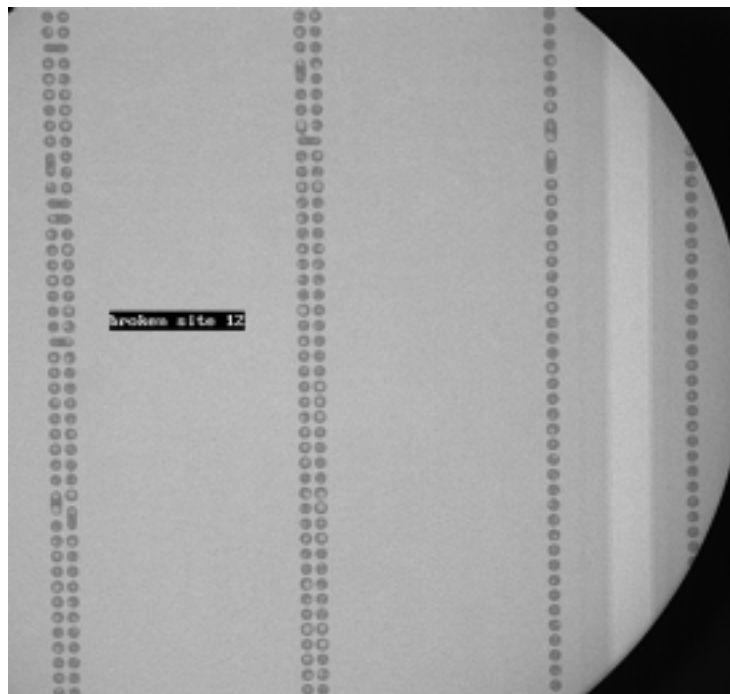

X-ray inspection of
solder bump 16 chip
module from IZM


Flip-chip assembly of
single detector to IC



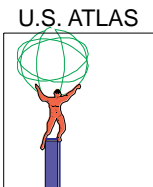


Bump Bonding - What Don't We Know?

- Should we choose one technology - solder or indium? Or should we allow both (equivalent to having two vendors?)
- Irradiated detectors with solder bumps OK?
- Yield with good confidence for all steps
- Impact of possible need for backside IC metallization on process steps
- Strength of bonds with good statistics
- Production rate for both wafer bump deposition or flip-chip assembly.
- Do we need more than one vendor for schedule reasons? Clearly desirable to reduce risk.
- QA program must exist but we haven't come close to implementing this with vendors. Are agreed that substantial collaboration involvement is required.

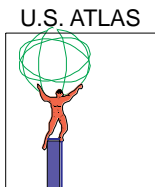


Bump Bonding Program

- Build many more modules - as many as we can afford
- Goal is to build 50+ active modules with prototype 2 sensors and FE-B and later FE-D/H chips by early 2000.
- This will be done at IZM and Alenia. Third vendor under consideration but not decided yet.
- 2nd generation dummy module program not yet fixed. Decide in June.
- Stay in touch with other programs(ALICE, FNAL pixels)
- Detailed schedule up to production is (just) under development (primarily by me) following selection of flex module baseline 3 weeks ago

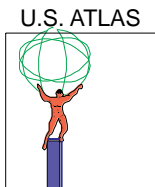

Module Assembly

- Only two flex modules have been assembled to date, one at Oklahoma and one at LBL.
- A few more with flex v1.0 will be made in Europe shortly.
- These have been and will be made to address electronics performance issues not module assembly.
- Production aspects of module assembly simply have not yet been addressed.
- Will begin to address these issues in about June of this year in preparation to prototype assembly tooling and procedures with modules made from 2nd prototype sensors and FE-B(first) and then FE-D chips.

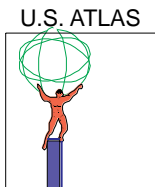

Module Assembly Plan

- Within the U.S., LBNL is responsible for module assembly but this relies on delivery of tested parts.
- We plan to have either direct responsibility in US or defined point of contact for all aspects during the development phase(through about mid-2000). We expect every step to also occur in Europe so coordination is important.
 - ♦ IC wafer probing(Einsweiler, Richardson, + labor)
 - ♦ Sensor wafer testing(Seidel, Hoferkamp, UNM postdoc)
 - ♦ Bump deposition and inspection(Gilchriese)
 - ♦ Dicing, thinning and metallization(Gilchriese, Palaio)
 - ♦ Flex production and testing(Skubic, Boyd, Timm, + labor)
 - ♦ Flip-chip assembly and inspection(X-ray)(Gilchriese + labor)
 - ♦ Bare module probing(Einsweiler, Richardson, LBL postdoc, LBNL engineering)
 - ♦ Module assembly tooling(Goozen, Zizka)
 - ♦ Module assembly(Goozen, Zizka + labor)
 - ♦ Assembled module testing(Einsweiler, Richardson, LBL postdoc, LBNL engineering initially, but migrates to other groups)
 - ♦ PPL upgrades and software(Richardson, Fasching, UW supported engineering)
 - ♦ Optical interface/tests(when relevant)(Gan, Kagan, OSU engineering)
 - ♦ Power cable interface/tests(Anderssen + testing group)
 - ♦ Module attachment interface(Anderssen)
 - ♦ Overall coordination(Gilchriese)